

Assembly instruction

Series MMBX

| |
|-------------|
| AC 28.06.00 |
| 4540/PM |

No.27351

Tools and materials required:

Stanley blade
Scissors
Crimp tool (see table below)

Straight connectors for flexible cable


 
 
Cable entry: crimped

Connector types: (e.g.)


11 MMBX-50-2-1

11 MMBX-50-2-2


| | | | |
|---------------------------------------|-----------------------|---------------|-----------------------|
| This connector is supplied in 3 parts | Suitable cables e.g.: | RG 316 B/U | K 02252 D EF 316 D |
| | Centre contact: | cavity 1 | cavity 1 |
| | Braid: | cavity A | cavity A |
| | Crimp tool: | 1, 2, A (red) | 1, 2, A (red) |

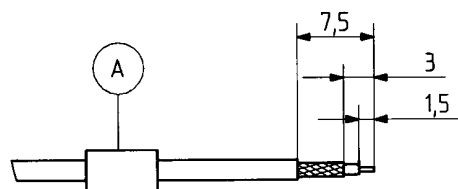


Slide ferrule A onto cable.
Prepare cable according to diagram.
CAUTION: Do not damage braid, dielectric and inner conductor of cable!

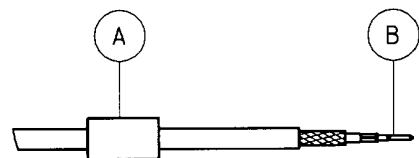

Push contact B over inner conductor of cable to about cable-dielectric and crimp with insert 1.

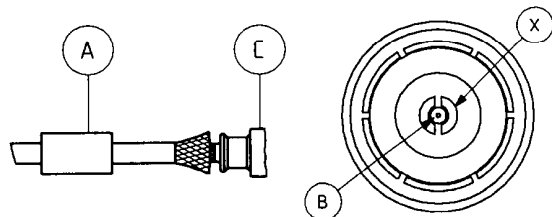

Splay out braid and insert cable in connector body C.
Check: Inner centre contact B have to be in the jack.
Ensure that braid lies above the crimp neck.

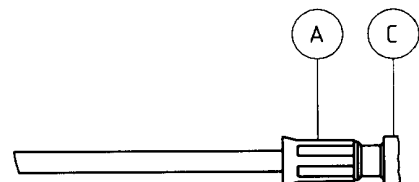

Slide ferrule A over braid and crimp as close to connector body C as possible.

SUHNER's skilled staff and specialised equipment are available to carry out complete R.F. lead-assembly on your behalf.
We mount your connectors on cables at economic prices! Please contact our representative for further details of this service.



HUBER + SUHNER AG CH-9100 HERISAU

Deutscher Text: siehe Rückseite