
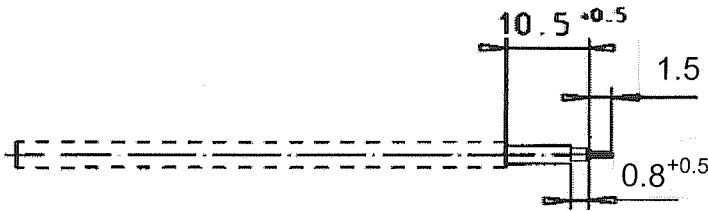


© THIS DRAWING IS THE EXCLUSIVE PROPERTY OF ROSENBERGER HOCHFREQUENZTECHNIK GMBH WITHOUT THEIR CONSENT IT MAY NOT BE REPRODUCED OR GIVEN TO THIRD PARTS.


**Winkelstecker**  
für Semi-rigid und Flex-Kabel

**Kabelbefestigung:**


Innenleiter: gelötet  
Aussenleiter: gelötet

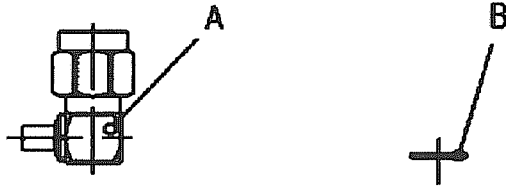

- 1) Kabel nach Zeichnung abisolieren.
- \*bei Flex-Kabel: FEP-Mantel nach Zeichnung abisolieren

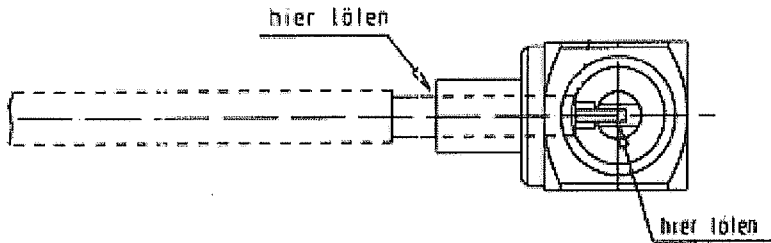

- 2) Vorbereitetes Kabel bis auf Anschlag in den Steckerkörper einschieben. Der Kabelinnenleiter muß dabei im Schlitz des Steckerinnenleiters zu liegen kommen.
- 3) Innenleiter an der angegebenen Stelle weichlöten.
- 4) Den Steckerkörper an der angegebenen Stelle weichlöten.

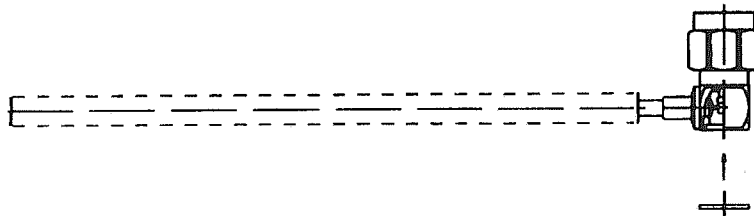

- 5) Lötöffnung mit Deckel „B“ verschließen.  
(Achtung: Bei Deckel mit Dichtung: auf Anschlag eindrücken!)



				Date	Name	<b>Werkzeuge:</b> Abisolierwerkzeug ..... Löttausrüstung ..... Einpreßwerkzeug ..... ..... ..... ..... .....	
			Drawn	20.03.06	A. Wallner		
			Check	22.03.06	<i>[Signature]</i>		
			Appr.	22.03.06	<i>[Signature]</i>		
			Dept.	TCC			
b00	07-0873	13.2.08	<i>[Signature]</i>	<b>Rosenberger®</b>			
a00	06-0152	20.03.06	A.W.				
Rev.	Change	Date	Name				
						M:	Seite 1 von 1

**Angel plug**


for semi-rigid and flexline cable;

**cable entry:**


center contact: soldered  
outer contact: soldered

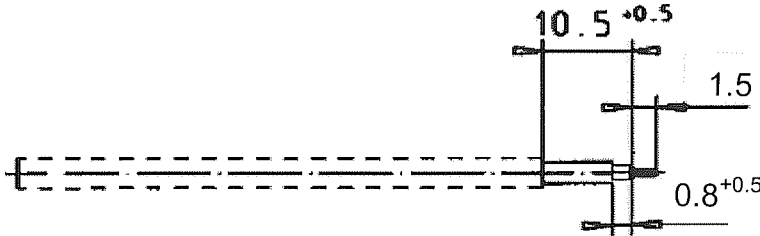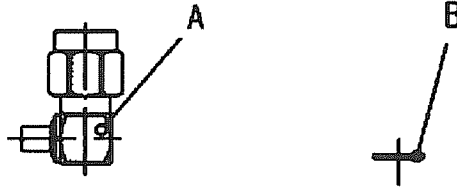

- 1) Prepare the cable according to the diagram.  
\*for flexible cable: FEP-Jacket prepare according to diagram.

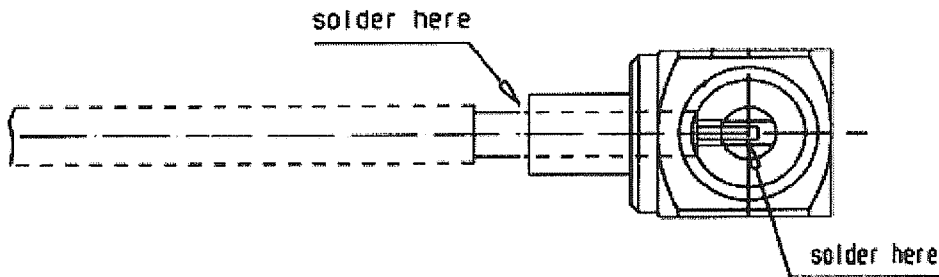

- 2) Insert the prepared cable fully into the connector body. Position the inner conductor of the cable in the slot of the center pin.
- 3) Solder the inner conductor in the shown position.
- 4) Solder the connector body "A" and the outer contact of the cable on the shown position.

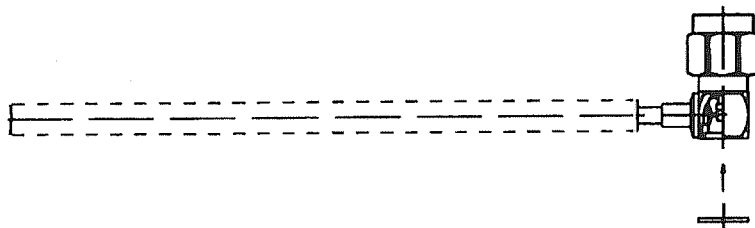

- 5) Press cover "B" into the rear aperture of the connector body.  
(Attention: If cover with sealing: press cover into connector body until stop!)

© THIS DRAWING IS THE EXCLUSIVE PROPERTY OF ROSENBERGER HOCHFREQUENZTECHNIK GMBH WITHOUT THEIR CONSENT IT MAY NOT BE REPRODUCED OR GIVEN TO THIRD PARTS.

				Date	Name	<b>Tools:</b> ..... stripping tool ..... Soldering equipment ..... Tool to press in cover ..... ..... ..... ..... .....
				Drawn	20.03.06 A. Wallner	
				Check	22.03.06 [Signature]	
				Appr.	22.03.06 [Signature]	
				Dept.	TCC	
600	07-0873	13.2.08	[Signature]	<b>Rosenberger®</b>		
a00	06-0152	20.03.06	A.W.			
Rev.	Change	Date	Name			
					M:	page 1 at 1