


- Machine Tap
- Maschinen-Gewindebohrer
- Machinetappen
- Tarauds machine
- Machos de máquina
- Macho de Máquina



## E200

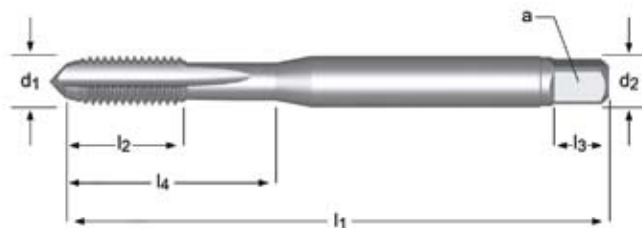

- 1.1 1.2 1.3 1.4 1.5 3.1 3.2 3.3 6.2 6.3 7.2 7.3 8.2

M	P mm	l <sub>1</sub> mm	l <sub>2</sub> mm	d <sub>2</sub> ∅ mm	a mm	l <sub>3</sub> mm	z	↔	l <sub>4</sub> mm	e-Code
2	0.40	45	6	2.8	2.1	5	3	1.6	9	E200M2
2.2	0.45	45	7	2.8	2.1	5	3	1.75	12	E200M2.2
2.5	0.45	50	8	2.8	2.1	5	3	2.05	12.5	E200M2.5
3	0.50	56	9	3.5	2.7	6	3	2.5	18	E200M3
3	0.50	56	9	3.5	2.7	6	3	2.5	18	E200M3NO1
3.5	0.60	56	11	4.0	3.0	6	3	2.9	20	E200M3.5
4	0.70	63	12	4.5	3.4	6	3	3.3	21	E200M4
4	0.70	63	12	4.5	3.4	6	3	3.3	21	E200M4NO1
5	0.80	70	13	6.0	4.9	8	3	4.2	25	E200M5
5	0.80	70	13	6.0	4.9	8	3	4.2	25	E200M5NO1
6	1.00	80	15	6.0	4.9	8	3	5	30	E200M6
6	1.00	80	15	6.0	4.9	8	3	5	30	E200M6NO1
7	1.00	80	15	7.0	5.5	8	3	6	30	E200M7
8	1.25	90	18	8.0	6.2	9	3	6.8	35	E200M8
8	1.25	90	18	8.0	6.2	9	3	6.8	35	E200M8NO1
10	1.50	100	20	10.0	8.0	11	3	8.5	39	E200M10
10	1.50	100	20	10.0	8.0	11	3	8.5	39	E200M10NO1

