

Product Safety Notification

Bulgin 900 Series Sockets

<b>Model No.</b>	<b>Stock no.</b>
PX0911/03/S	RS 344-4043
PX0911/04/S	RS 344-4059
PX0941/04/S	RS 345-0824

We have received a notification from Bulgin of a potential problem with certain of their 900 series sockets supplied in March and June 2008.

According to our records you have purchased one or more of these connectors.

The earth terminal on these connectors is designed to make connection first and break connection last.

To achieve this, the earth socket terminal should have been mounted forward of the remaining terminals.

There is a possibility that this is not the case and an adjacent terminal may instead be mounted forward.

Please refer to the enclosed sheet for further details of the fault and directions as to how to determine if the connector(s) you have are affected.


If you find that you have one or more of the affected sockets and require replacement please contact our Customer Care Team on tel 01536 444 386.

We apologise for any inconvenience caused but are sure that you will understand the importance of this notification.

## Product Safety Notification

Bulgin (Elektron Components Ltd.) 900 Series Sockets

Bulgin Part No.	RS Stock no.
PX0911/03/S	RS 344-4043
PX0911/04/S	RS 344-4059
PX0941/04/S	RS 345-0824

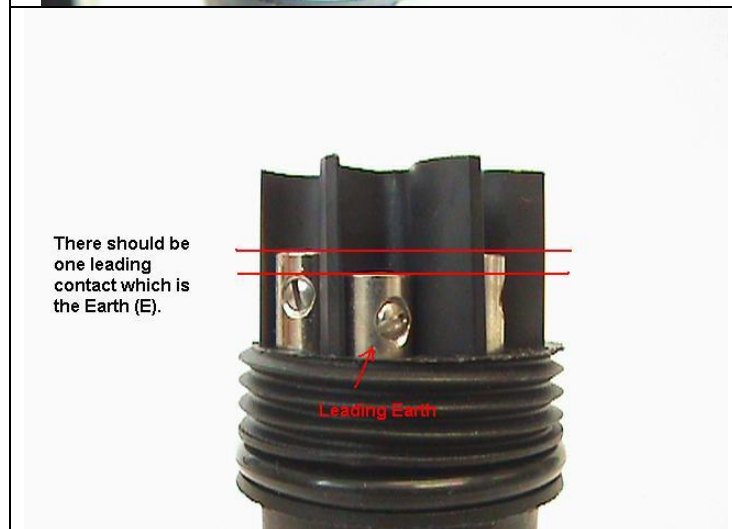

If you find that the sockets you have are faulty and you require replacements please contact the RS Customer Care Team on tel. 01536 444 386 or email [customer.care@rs-components.com](mailto:customer.care@rs-components.com)