

NOTE All numerical values are in metric units [with U.S. customary units in brackets]. Dimensions are in millimeters [and inches]. Unless otherwise specified, dimensions have a tolerance of ± 0.13 [$\pm .005$] and angles have a tolerance of $\pm 2^\circ$. Figures and illustrations are for identification only and are not drawn to scale.

1. INTRODUCTION

This specification covers the requirements for application of PIDG FASTON receptacle contacts. The contacts are available in Series 250 (6.35 [.250]), 205 (5.21 [.205]), 187 (4.75 [.187]), and 110 (2.79 [.110]). The series designator corresponds to the width of the contact mating end (in thousands of an inch). The contact insulation is color coded to provide a visual reference applicable to the wire size range suitable for the contact. The serrations inside the wire barrel provide maximum contact and tensile strength after crimping. These contacts are available in loose-piece for terminating with manual hand-held tools, and in tape-mounted or reel-mounted form for terminating with machines.

The contacts accept mating tabs in Series 250 (6.35 [.250]), 205 (5.21 [.205]), 187 (4.75 [.187]), and 110 (2.79 [.110]). The series designator corresponds to the width of the tab mating end (in thousands of an inch).

When corresponding with personnel, use the terminology provided in this specification to facilitate your inquiries for information. Basic terms and features of this product are provided in Figure 1.

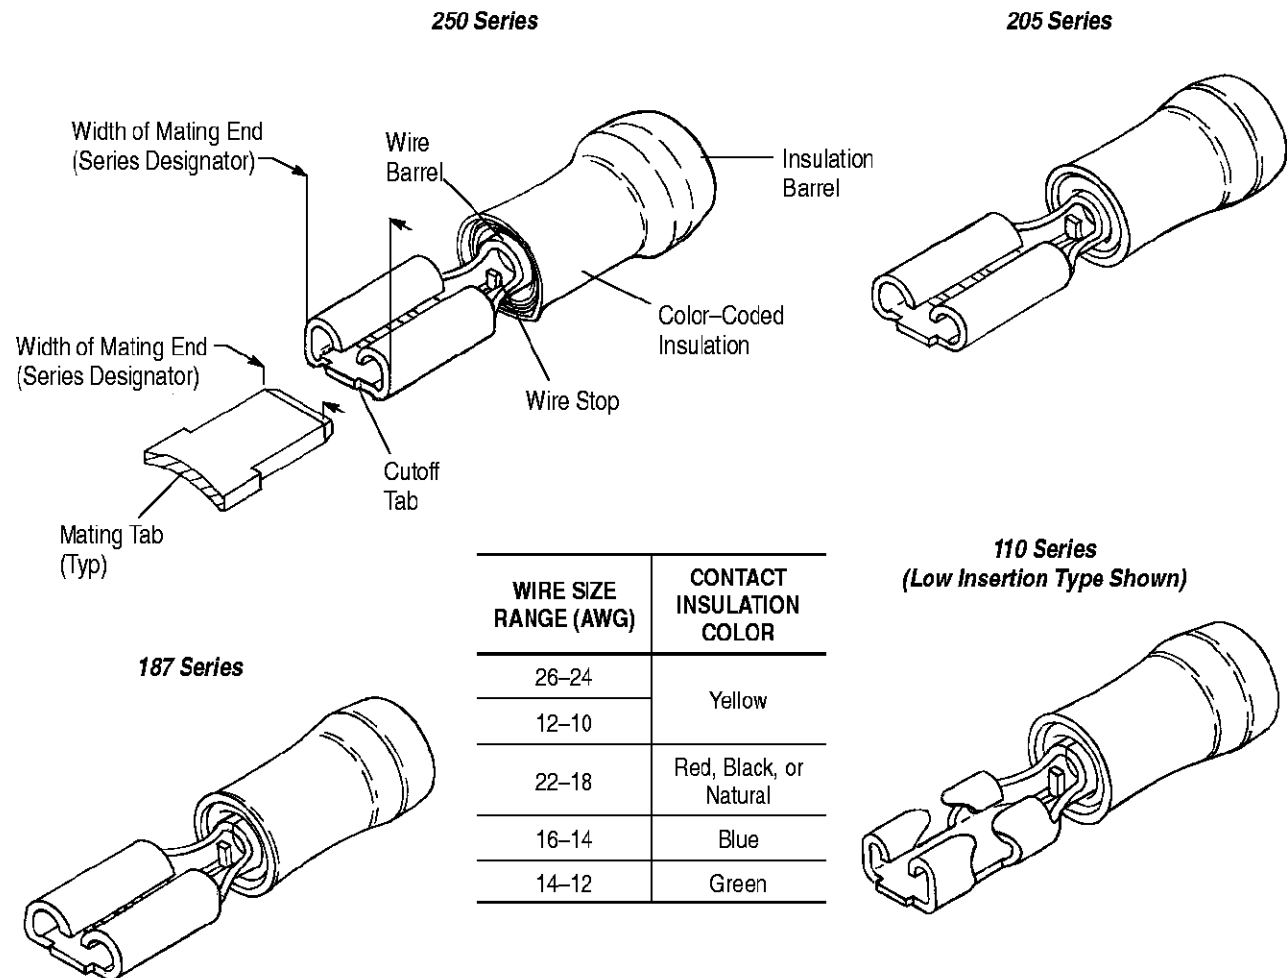


Figure 1

2. REFERENCE MATERIAL

2.1. Revision Summary

Revisions to this application specification per EC 0990-1188-02 include:

- Updated document to corporate requirements
- Added information to Sections 1 and 4, and Paragraphs 3.3 and 3.4
- Changed product code in Paragraph 2.2
- Modified Paragraph 2.5
- Removed force gage from Paragraph 3.3,D
- Added Machines 1338600-[], 356500-1, 354500-[], and 21750-[] to Section 5
- Removed obsolete Machine 818380-1 and obsolete Applicator 687872-1 from Section 5
- Removed Applicator 818057-2 from Section 5
- Moved position of Tool 90185-1 from Die 59826-1 under Series 205 in Figure 9

2.2. Customer Assistance

Reference Product Part Number 640903 and Product Code 1164 are representative of PIDG FASTON receptacle contacts. Use of these numbers will identify the product line and expedite your inquiries through a service network established to help you obtain product and tooling information. Such information can be obtained through a local Representative (Field Service Engineer, Field Applications Engineer, etc.) or, after purchase, by calling PRODUCT INFO at the number at the bottom of page 1.

2.3. Drawings

Customer Drawings for product part numbers are available from the service network. If there is a conflict between the information contained in the Customer Drawings and this specification or with any other technical documentation supplied, call PRODUCT INFO at the number at the bottom of page 1.

2.4. Specifications

Product Specification 108-1033 provides product performance and test information.

2.5. Instructional Material

Instruction Sheets (408-series) provide product assembly instructions or tooling setup and operation procedures and Customer Manuals (409-series) provide machine setup and operation procedures. Documents available which pertain to this product are:

- 408-1559 Hand Crimping Tool 48518-2
- 408-2423 Crimping Die Assembly 69877-2
- 408-2822 Crimping Die Assemblies 59826-1, 59827-1, and 59828-1
- 408-2823 TETRA-CRIMP* Hand Crimping Tool 59824-1
- 408-3295 Preparing Reel of Contacts for Application Tooling
- 408-7278 Hand Crimping Tool 90185-1
- 408-7424 Checking Terminal Crimp Height Gaging Die Closure
- 408-7426 Hand Crimping Tool 90246-1
- 408-7563 Crimping Die Assemblies 90240-2 and 90248-2
- 408-7903 Hand Crimping Tool 90276-2
- 408-8040 Heavy Duty Miniature Quick-Change Applicators (Side-Feed Type) with Mechanical Feed System
- 408-8044 Miniature Quick-Change Applicator for Tape-Mounted Closed Barrel Terminals
- 408-8063 TETRA-CRIMP Heavy-Duty Miniature Quick-Change Applicators (Side-Feed Type) with Air Feed for FASTON Terminals
- 408-8082 Miniature Quick-Change Applicators (Side-Feed Type) With Air Feed for Tape-Mounted PIDG Terminals
- 408-9816 Handling of Reeled Products
- 409-1993 AMP-TAPETRONIC* Machine 69875

- 409-5728 AMP-O-ELECTRIC* Model "K" Terminating Machine 565435-5
- 409-5842 AMP-O-ELECTRIC Model "G" Terminating Machine 354500-[]
- 409-5852 AMPOMATOR* CLS III-G Lead-Making Machine 122500-[]
- 409-5866 AMPOMATOR CLS IV Lead-Making Machine 217500-[]
- 409-5878 AMPOMATOR CLS IV+ Lead-Making Machine 356500-[]
- 409-10016 Entry Level Terminator (ELT) Machine 1338600-[]

3. REQUIREMENTS

3.1. Storage

A. Ultraviolet Light

Prolonged exposure to ultraviolet light may deteriorate the chemical composition used in the contact insulation material.

B. Reel Storage

When using reeled contacts, store coil wound reels horizontally and traverse wound reels vertically.

C. Shelf Life

The contacts should remain in the shipping containers until ready for use to prevent deformation to the contact. The contacts should be used on a first in, first out basis to avoid storage contamination that could adversely affect signal transmissions.

D. Chemical Exposure

Do not store contacts near any chemicals listed below as they may cause stress corrosion cracking in the contacts.

| | | | | | |
|----------|------------|----------|-----------------|----------|------------------|
| Alkalies | Ammonia | Citrates | Phosphates | Citrates | Sulfur Compounds |
| Amines | Carbonates | Nitrites | Sulfur Nitrites | | Tartrates |


NOTE *Where the above environmental conditions exist, phosphor-bronze contacts are recommended instead of brass contacts.*

3.2. Wire Selection and Preparation

The contacts will accept solid or stranded copper wire sizes 26 through 10 AWG with an insulation diameter range of 1.02 through 6.35 [.040 through .250].

Proper strip length is necessary to properly insert the wire into the contact. Reasonable care must be taken not to nick, scrape, or cut any part of the wire during the stripping operation. The strip length of the wire is shown in Figure 2.

Note: Not to Scale

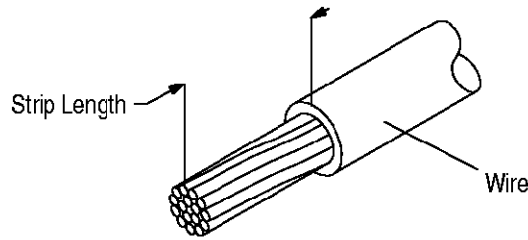

| CONTACT | | WIRE | | |
|---------|------------------|------------------|---------------------------|---------------------------|
| SERIES | COLOR CODE | SIZE RANGE (AWG) | INSULATION DIAMETER RANGE | STRIP LENGTH ±0.41 [.016] |
| 110 | Yellow | 26-24 | 1.27-2.08 [.050-.082] | 6.76 [.266] |
| | Black or Natural | 22-18 | 1.02-2.79 [.040-.110] | 5.16 [.203] |
| | Red | | 2.67-3.56 [.105-.140] | 7.92 [.312] |
| | Blue | 16-14 | 2.92-4.32 [.115-.170] | 7.92 [.312] |
| 187 | Yellow | 26-24 | 1.27-2.08 [.050-.082] | 5.16 [.203] |
| | Red | 22-18 | 2.67-3.56 [.105-.140] | 7.92 [.312] |
| | Blue | 16-14 | 2.92-4.32 [.115-.170] | |
| 205 | Red | 22-18 | 2.67-3.56 [.105-.140] | 7.92 [.312] |
| | Blue | 16-14 | 2.92-4.32 [.115-.170] | |
| 250 | Red | 22-18 | 2.62-3.56 [.105-.140] | 7.92 [.312] |
| | Blue | 16-14 | 2.92-4.32 [.115-.170] | 7.92 [.312] |
| | Green | 14-12 | 3.81-6.35 [.150-.250] | 8.74 [.344] |
| | Yellow | 12-10 | 3.81-6.35 [.150-.250] | 8.74 [.344] |

Figure 2

3.3. Crimp Requirements

NOTE Periodic inspections must be made to ensure crimped contact formation is consistent as shown in Figure 3.

A. Conductor Location

The wire conductors must be located between the contact wire stop and wire barrel. See Figure 3.

B. Cutoff Tab and Burr

Cutoff tabs are the remaining portion of the carrier strip after the contact is cut from the strip. The following dimensional requirements will ensure proper application for these contacts.

1. The cutoff tab must not exceed the dimension shown in Figure 3.
2. There shall be no burr resulting from the cutoff tab shearing.

C. Wire Barrel and Insulation Barrel Crimp

The crimped area must be symmetrical on both sides of the wire barrel and insulation barrel of contact. The crimp may be off center but not off the end of the wire barrel or insulation barrel. All wire conductors must be held firmly inside the wire barrel. No strands can be folded back over the wire insulation. The insulation of the contact must not be deformed, cut, or show stress marks. See Figure 3.

D. Crimp Height

Because these contacts are insulated, crimp height readings cannot be measured over the insulation. Therefore, to check for proper crimp height, a piece of solid-core solder must be crimped. Solder with a ratio of 60% tin to 40% lead is recommended. Diameter of the solder must be as stated in Figure 3.


The height of the crimped solder must be checked against the crimp height dimensions stated in the instructional material shipped with the application tooling. Gaging procedures are described in 408-7424.

NOTE Solder must not be used in tools that crimp non-insulated contacts, unless specified by engineering (solder particles could jam tooling locators, wire stops, ejectors, etc.).

CAUTION Crimp height dimensions must not be applied directly to the contact. Applying crimp height dimensions directly to the contact will over-crimp the contact, cracking the wire barrel, and possibly causing damage to the tooling.

E. Bellmouths

The front and rear bellmouths shall be evident as shown in Figure 3.

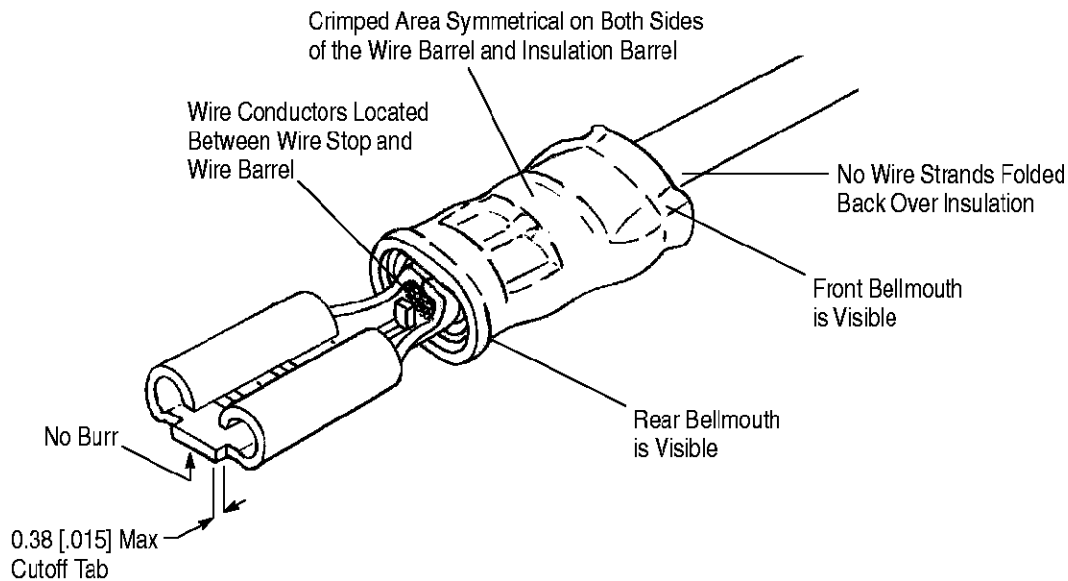

| CRIMP HEIGHT INSPECTION | |
|-------------------------|---|
| WIRE SIZE RANGE (AWG) | SOLDER DIAMETER |
| 26-18 | 3.18 [.125] [¹ / ₈] |
| 16-14 | 4.76 [.1875] [³ / ₁₆] |
| 14-10 | 6.35 [.250] [¹ / ₄] |

Figure 3

F. Straightness

There shall be no twist, roll, deformation, or other damage to the mating portion of the crimped contact that will prevent proper mating. See Figure 4.

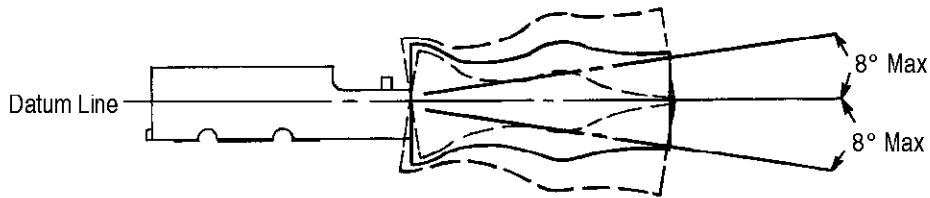


Figure 4

G. Tensile Inspection

Crimped contacts should hold the wire firmly and have a pull-test tensile value specified in Figure 5.

NOTE Tensile testing machine should be adjusted for head travel of 25.4 [1.0] per minute. Force should be applied directly and gradually for 1 minute.

| WIRE SIZE (AWG) | CRIMP PULL-OUT TEST MINIMUM FORCE (N [lbs]) |
|-----------------|---|
| 26 | 13.3 [3] |
| 24 | 22.2 [5] |
| 22 | 35.6 [8] |
| 20 | 57.8 [13] |
| 18 | 89 [20] |
| 16 | 133.4 [30] |
| 14 | 222.4 [50] |
| 12 | 311.4 [70] |
| 10 | 355.9 [80] |

Figure 5


3.4. Mating Tab

A. Dimensions

Features and dimensional requirements for tabs intended for mating with these contacts are shown in Figure 6.

NOTE Dimensional measurements shall not include plating, burrs, or flatness tolerance.

NOTE Top and bottom tab surfaces shall be flat within .1% and free from burrs greater than 10% of tab thickness, or raised plateaus except as noted in Section 3.3.C, Testing.

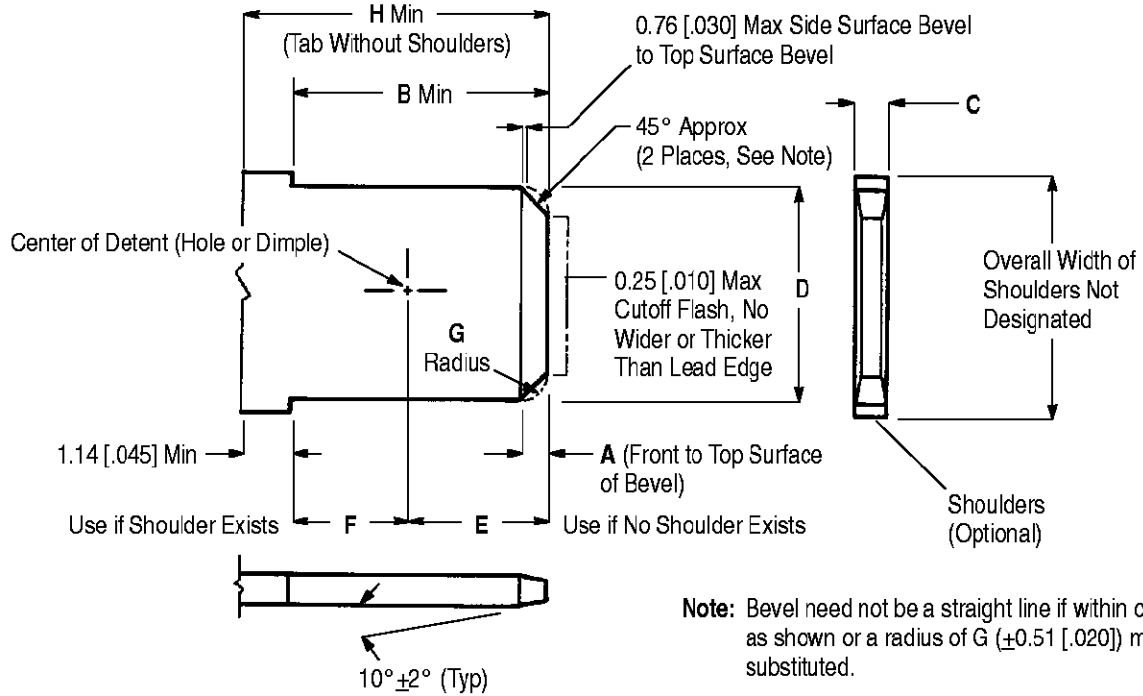


| MATING TAB | DIMENSION | | | | | | | |
|---|------------------------|----------------|------------------------|------------------------|------------------------|------------------------|------------------------|----------------|
| | A ± 0.13 [.005] | B (Min) | C ± 0.03 [.001] | D ± 0.08 [.003] | E ± 0.20 [.008] | F ± 0.08 [.003] | G ± 0.51 [.020] | H (Min) |
| 6.35 × 0.81 [.250 × .032] With Dimple | 0.89 [.035] | 7.8 [.307] | 0.81 [.032] | 6.35 [.250] | 3.86 [.152] | 4.06 [.160] | 1.27 [.050] | 8.94 [.352] |
| 6.35 × 0.81 [.125 × .032] With Hole | 0.89 [.035] | 7.8 [.307] | 0.81 [.032] | 6.35 [.250] | 4.52 [.178] | 3.4 [.134] | 1.27 [.050] | 8.94 [.352] |
| 5.21 × 0.81 [.205 × .032] With Hole | 0.89 [.035] | 6.22 [.245] | 0.51 [.020] | 5.26 [.207] | 3.18 [.125] | 3.18 [.125] | 1.14 [.045] | 7.37 [.290] |
| 5.21 × 0.81 [.205 × .032] With Dimple | 0.89 [.035] | 6.22 [.245] | 0.81 [.032] | 5.26 [.207] | 2.54 [.100] | 3.81 [.150] | 1.27 [.050] | 7.37 [.290] |
| 5.21 × 0.51 [.205 × .020] With Hole | 0.89 [.035] | 6.22 [.245] | 0.81 [.032] | 5.26 [.207] | 3.18 [.125] | 3.18 [.125] | 1.27 [.050] | 7.37 [.290] |
| 4.75 × 0.51 [.187 × .020] With Dimple | 0.76 [.030] | 6.22 [.245] | 0.51 [.020] | 4.75 [.187] | 2.54 [.100] | 3.81 [.150] | 1.14 [.045] | 7.37 [.290] |
| 4.75 × 0.51 [.187 × .020] With Hole | 0.76 [.030] | 6.22 [.245] | 0.51 [.020] | 4.75 [.187] | 3.18 [.125] | 3.81 [.150] | 1.14 [.045] | 7.37 [.290] |
| 2.79 × 0.81 [.110 × .032] With Dimple or Hole | 0.51 [.020] | 6.98 [.275] | 0.81 [.032] | 2.79 [.110] | 1.57 [.062] | 5.54 [.218] | 0.89 [.035] | 8.13 [.320] |
| 2.79 × 0.51 [.110 × .020] With Dimple or Hole | 0.51 [.020] | 6.98 [.275] | 0.51 [.020] | 2.79 [.110] | 1.57 [.062] | 5.54 [.218] | 0.89 [.035] | 8.13 [.320] |

Figure 6

B. Retention and Detent (Hole and Dimple) Configurations

A tab configuration having no locking feature may be used for applications where low mating retention forces are desirable. Holes provide the greatest retention forces and dimples provide acceptable medium-range forces. Where higher forces are sought, a tab hole should meet the requirements shown in Figure 7.

NOTE Hole or dimple detents may be at the same location on the longitudinal centerline if no shoulder or obstruction is present at the base of the tab.

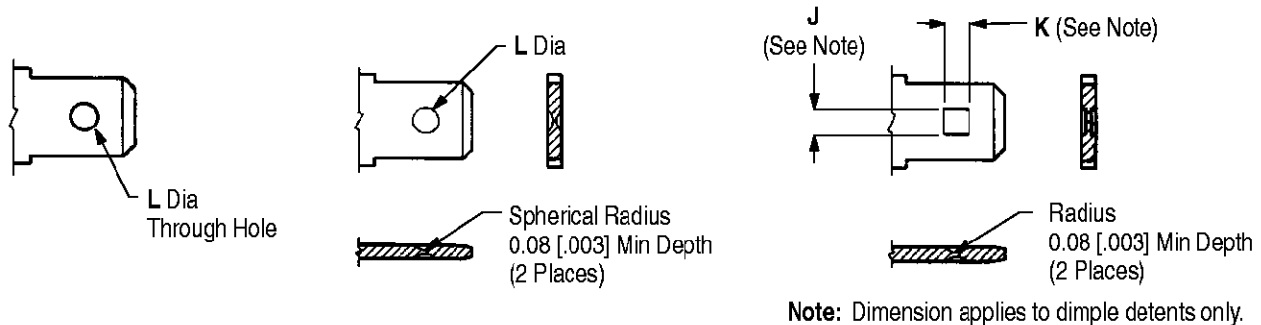

| MATING TAB SERIES | DIMENSION | | |
|-------------------|--------------------|--------------------|---------------------------------------|
| | J ±0.13 [±.005] | K ±0.13 [±.005] | L (Dia) |
| 250 | 2.36 [.093] | 1.9 [.075] | 1.78+0.25/-0.13 [.070+.010/-0.005] |
| 205 | 2.36 [.093] | 1.9 [.075] | 1.78+0.25/-0.13 [.070+.010/-0.005] |
| 187 | 1.57 [.062] | 1.37 [.054] | 1.4±0.13 [.055±.005] |
| 110 | 1.57 [.062] | 1.22 [.048] | 1.22±0.08 [.048±.003] |

Figure 7

C. Testing

Mating and unmating force must be measured using a testing device capable of holding the reading. It must also provide accurate alignment with slow and steady mating and unmating of the test tab and contact. Testing may be performed as described in National Electrical Manufacturers Association (NEMA) DC 2, “Residential Controls—Quick-Connect Terminals.”

Test mating tabs must have dimensions as specified in Figure 6, except for the following:

1. Dimension C must have a tolerance of ±0.008 [±.0003] for brass tabs and ±0.013 [±.0005] for steel tabs.
2. Raised plateaus around detents must be limited to a total of 0.03 [.001] for both sides.

The forces required to mate and unmate a test mating tab and contact shall be as specified in Figure 8.

| MATING TAB SERIES | MATING AND UNMATING FORCES (N [lbs]) | | | | | |
|-------------------|--------------------------------------|----------------------|----------------------|------------|----------------------|------------|
| | FIRST INSERTION (Max) | FIRST WITHDRAW (Max) | FIRST WITHDRAW (Min) | | SIXTH WITHDRAW (Min) | |
| | Individual | | Average | Individual | Average | Individual |
| 250 | 76 [17] | 76 [17] | 22 [5] | 13 [3] | 18 [4] | 13 [3] |
| 250 (Unplated) | 80 [18] | 80 [18] | 27 [6] | 18 [4] | 22 [5] | 18 [4] |
| 205 | 67 [15] | 89 [20] | 22 [5] | 13 [3] | 13 [3] | 9 [2] |
| 187 | 67 [15] | 89 [20] | 22 [5] | 13 [3] | 13 [3] | 9 [2] |
| 110 | 53 [12] | 62 [14] | 13 [3] | 9 [2] | 9 [2] | 4 [1] |

Figure 8

3.5. Repair

The contacts are not repairable once a termination has been made. Any defective or damaged contact must be replaced. These contacts must not be re-used by removing the wire.

4. QUALIFICATION

PIDG FASTON receptacle contacts are recognized component by Underwriters Laboratories Inc. (UL) under File E 66717 and Certified by Canadian Standards Association (CSA) under File LR 7189.


UL 310, "Standard for Electrical Quick-Connect Terminals" and CSA 22.2 #153, "Quick-Connect Terminals" provides product performance requirements and test information for all wire sizes except 26 through 24 AWG.

5. TOOLING


Tooling part numbers and instructional material packaged with the tooling are shown in Figure 9.

NOTE


For assistance in setting up prototype and production line equipment, contact the TOOLING ASSISTANCE CENTER at the number at the bottom of page 1.




Die Assembly (Typ, Refer to Table)

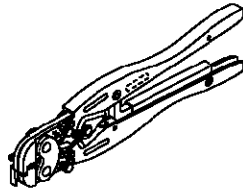

Hand Crimping Tool (Typ, Refer to Table)

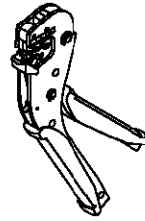


TETRA-CRIMP Hand Crimping Tool 59824-1 (408-2823)

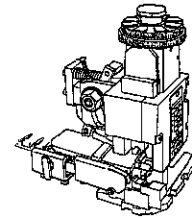


Applicator (Typ, Refer to Table)

NOTE Only TETRA-CRIMP tools should be used for UL and CSA applications.


| DESCRIPTION | PART NUMBER | DOCUMENT NUMBER |
|--------------|--------------|-----------------|
| Hand Tool | 48518-2 | 408-1559 |
| | 90185-1 | 408-7278 |
| | 90246-1 | 408-7426 |
| | 90276-2 | 408-7903 |
| Die Assembly | 59826-1 | 408-2822 |
| | 59827-1 | 408-2822 |
| | 59828-1 | 408-2822 |
| | 69877-2 | 408-2423 |
| | 90240-2 | 408-7563 |
| | 90248-2 | 408-7563 |
| Applicator | 466554-3 | 408-8040 |
| | 466788-3 | 408-8063 |
| | 466788-4 | 408-8063 |
| | 466789-3 | 408-8063 |
| | 466789-4 | 408-8063 |
| | 466790-4 | 408-8063 |
| | 567200-2, -3 | 408-8082 |
| | 687658-1 | 408-8044 |
| 687987-1 | 408-8040 | |

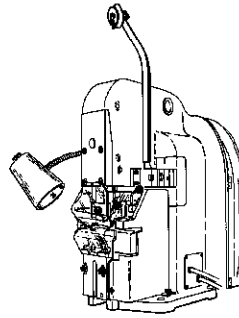


AMP-TAPETRONIC Machine 69875 (409-1993)

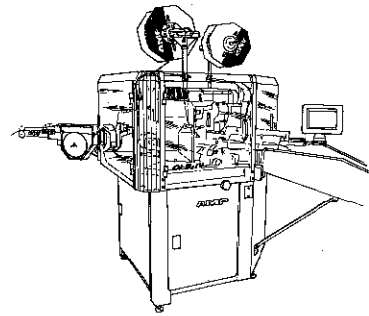


AMPOMATOR CLS IV Lead-Making Machine 217500-[] (409-5866)
No Longer Manufactured New

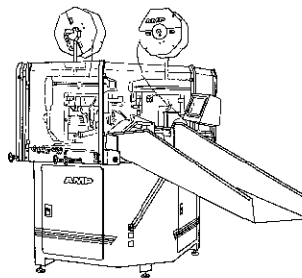


AMPOMATOR CLS III-G Lead-Making Machine 122500-[] (409-5852)
No Longer Manufactured New

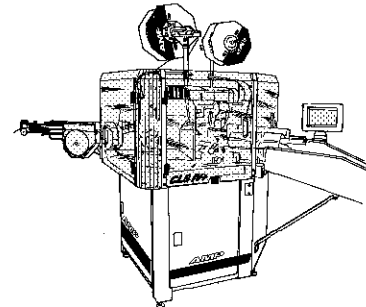


AMPOMATOR CLS IV + Lead-Making Machine 356500-[] (409-5878)

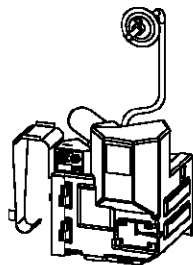

ELT Machine 1338600-[] (409-10016)

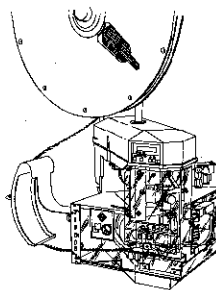

AMP-O-LECTRIC Model "G" Terminating Machine 354500-[] (409-5842)

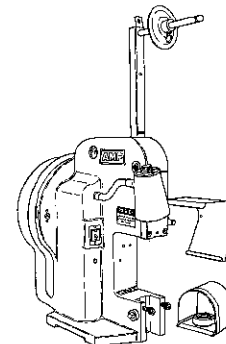

AMP-O-LECTRIC Model "K" Terminating Machine 565435-5 (409-5728)
No Longer Manufactured New

Figure 9 (cont'd)

| CONTACT SERIES | WIRE SIZE RANGE (AWG) | HAND TOOL | DIE ASSEMBLY (For Reeled Contacts Only) | APPLICATOR | POWER UNIT |
|----------------|-----------------------|-----------|---|---------------------------|---------------------------|
| 110 | 26-24 | 48518-2 | — | — | — |
| | | — | 69877-2 | 567200-2 | 565435-5 |
| | | | | 567200-3 | 354500-[] or 1338600-[] |
| | | | | 687658-1 | 122500-[] or 356500-[] |
| | | | | — | 69875 |
| | 22-18 | 59824-1 | | — | — |
| | | 90185-1❧ | | | |
| | | — | 59826-1 | 567200-2 | 565435-5 |
| | 567200-3 | | | 354500-[] or 1338600-[] | |
| | 687658-1 | | | 122500-[] or 356500-[] | |
| | — | | | 69875 | |
| | — | | — | 466554-3 | 565435-5 |
| | | | | 466788-3 | 122500-[] or 356500-[] |
| | | | | 687987-1 or 466788-4 | 565435-5 |
| | 16-14 | — | 59827-1 | 567200-2 | 565435-5 |
| | | | | 567200-3 | 354500-[] or 1338600-[] |
| | | | | 687658-1 | 122500-[] or 356500-[] |
| | | | | — | 69875 |

❧ For contacts with natural or black insulation only.

Figure 9 (cont'd)

| CONTACT SERIES | WIRE SIZE RANGE (AWG) | HAND TOOL | DIE ASSEMBLY (For Reeled Contacts Only) | APPLICATOR | POWER UNIT | | |
|----------------|-----------------------|--------------------------|---|--------------------------|---------------------------|---------|---------------------------|
| 187 | 26-24 | 48518-2 | — | — | — | | |
| | | — | 69877-2 | 567200-2 | 565435-5 | | |
| | | | | 567200-3 | 354500-[] or 1338600-[] | | |
| | | | | 687658-1 | 122500-[] or 356500-[] | | |
| | — | 69875 | | | | | |
| | 22-18 | 59824-1 | — | — | — | — | |
| | | — | 59826-1 | 567200-2 | 565435-5 | | |
| | | | | 567200-3 | 354500-[] or 1338600-[] | | |
| | | | | 687658-1 | 122500-[] or 356500-[] | | |
| | | | | — | 69875 | | |
| | | — | — | 466788-3 | 122500-[] or 356500-[] | | |
| | | | | 466788-4 | 565435-5 | | |
| | | | | 16-14 | — | 59827-1 | 567200-2 |
| | 567200-3 | | | | | | 354500-[] or 1338600-[] |
| | 687658-1 | 122500-[] or 356500-[] | | | | | |
| | — | 69875 | | | | | |
| | — | — | 466789-3 | 122500-[] or 356500-[] | | | |
| | | | 466789-4 | 565435-5 | | | |
| 205 | 22-18 | 59824-1 | — | — | — | | |
| | | — | 59826-1 | 567200-2 | 565435-5 | | |
| | | | | 567200-3 | 354500-[] or 1338600-[] | | |
| | | | | 687658-1 | 122500-[] or 356500-[] | | |
| | — | 69875 | | | | | |
| | — | 90185-1 | — | 466788-3 | 122500-[] or 356500-[] | | |
| | | | | 466788-4 | 565435-5 | | |
| | 16-14 | — | 59827-1 | 59824-1 | — | | |
| | | | | 567200-2 | 565435-5 | | |
| | | | | 567200-3 | 354500-[] or 1338600-[] | | |
| | | | | 687658-1 | 122500-[] or 356500-[] | | |
| | — | 69875 | | | | | |

■ For contacts with natural insulation only.

Figure 9 (cont'd)

| CONTACT SERIES | WIRE SIZE RANGE (AWG) | HAND TOOL | DIE ASSEMBLY (For Reeled Contacts Only) | APPLICATOR | POWER UNIT | | |
|----------------|-----------------------|---------------------------|---|---------------------------|---------------------------|----------|----------|
| 250 | 22-18 | 59824-1 | — | — | — | | |
| | | — | 59826-1 | 567200-2 | 565435-5 | | |
| | | | | 567200-3 | 354500-[] or 1338600-[] | | |
| | | | | 687658-1 | 122500-[] or 356500-[] | | |
| | | | | — | 69875 | | |
| | | — | — | 466788-3 | 122500-[] or 356500-[] | | |
| | | | | 466788-4 | 565435-5 | | |
| | | | | 16-14 | 59824-1 | — | — |
| | — | | | | 59827-1 | 567200-2 | 565435-5 |
| | | 567200-3 | 354500-[] or 1338600-[] | | | | |
| | | 687658-1 | 122500-[] or 356500-[] | | | | |
| | | — | 69875 | | | | |
| | — | — | 466789-3 | | 122500-[] or 356500-[] | | |
| | | | 466789-4 | | 565435-5 | | |
| | | | 14-12 | | 90246-1 | — | — |
| | | | | — | 90240-2 | 567200-2 | 565435-5 |
| | 567200-3 | 354500-[] or 1338600-[] | | | | | |
| | 687658-1 | 122500-[] or 356500-[] | | | | | |
| | — | 69875 | | | | | |
| | 12-10 | 59824-1 | — | — | — | — | |
| 90276-2 | | | | | | | |
| — | | 59828-1 | 567200-2 | 565435-5 | | | |
| | | | 567200-3 | 354500-[] or 1338600-[] | | | |
| | | | 687658-1 | 122500-[] or 356500-[] | | | |
| | | | — | 69875 | | | |
| — | — | 466790-4 | 565435-5 | | | | |

Figure 9 (end)

6. VISUAL AID

The illustration below shows a typical application of PIDG FASTON receptacle contacts. This illustration should be used by production personnel to ensure a correctly applied product. Applications which DO NOT appear correct should be inspected using the information in the preceding pages of this specification and in the instructional material shipped with the product or tooling.

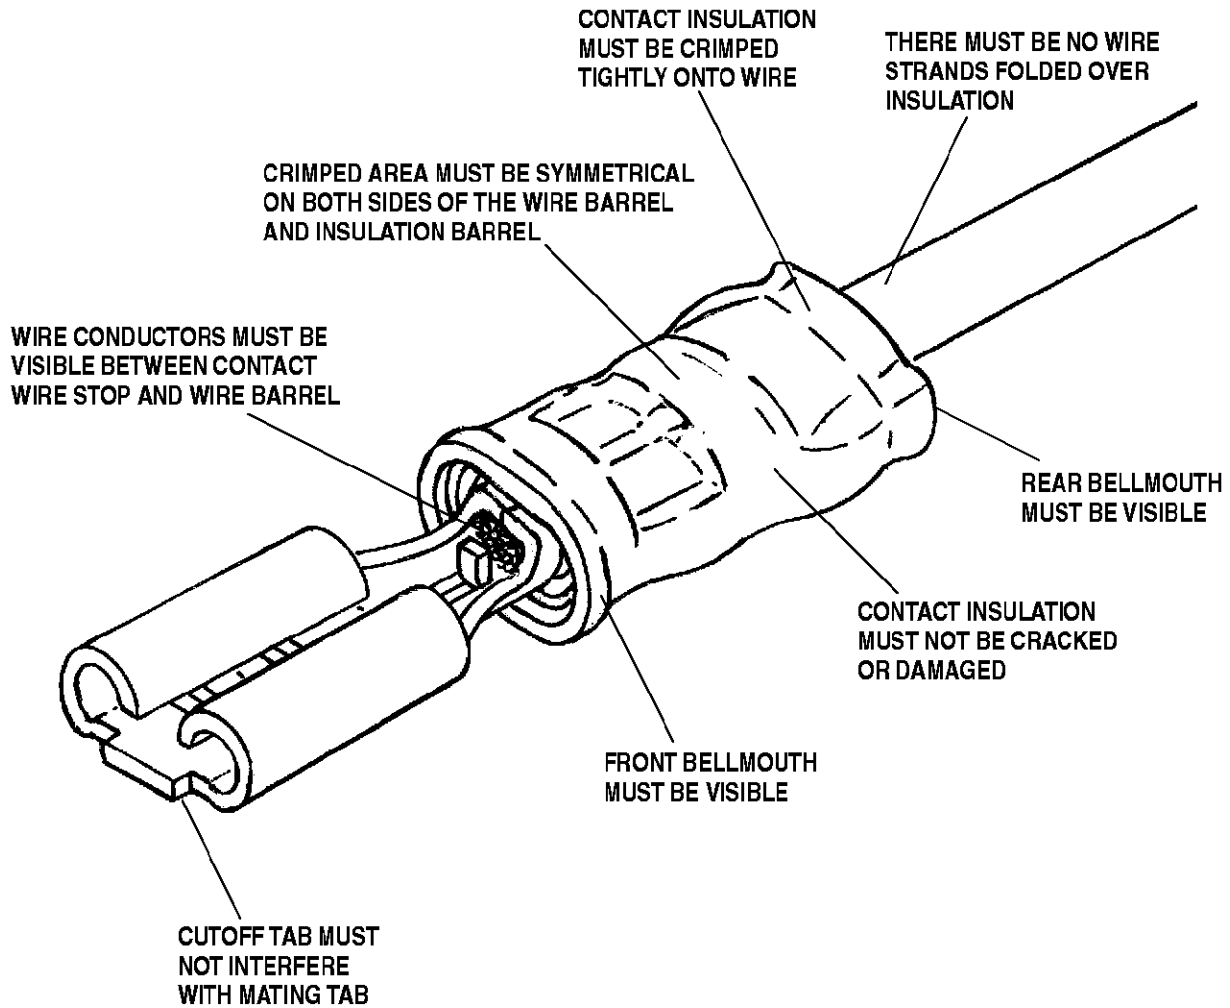


FIGURE 10. VISUAL AID