
UNCONTROLLED DOCUMENT


PART NUMBER


LPA-C011301S-X

REV.

							1
REV.	E.C.N.	NUMBER	AND	REVISION	COMMENTS	D/	4TE
Α	E,C,N.	#10924.				11.	4.02

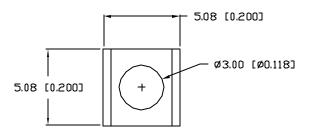


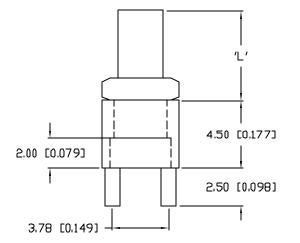

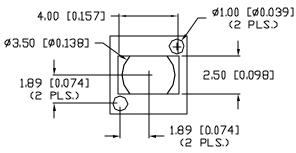

REPLACES PART #: LLP-LXC010301S-X


REV.

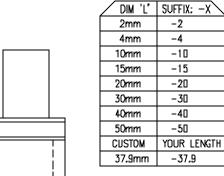

/ Dim L	OOITING A
2mm	-2
4mm	-4
10mm	-10
15mm	-15
20mm	-20
30mm	-30
40mm	-40
50mm	-50
CUSTOM	YOUR LENGTH
37 . 9mm	-37.9

NOTES:

- MATERIAL; CLEAR POLYCARBONATE UL94V-0, (LIGHT PIPE)
- 2. MATERIAL: BLACK NORYL, UL94V-O. (HOLDER)
- 3. TEMP. RANGE: -60°C TO +125°C.
- 4. RECOMMENDED LED: SML-LX08D5xx SERIES.

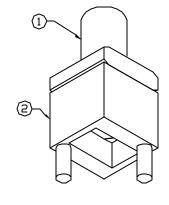

3.78 [0.149] PCB LAYOUT 1.20 [0.047] 3.78 [0.149] 🖾 Ø1.00 [Ø0.039] 1.20 [0.047] (2 PLS₁) (2 PLS.) ·- 0.90 [0.035]

3.78 [0.149]

PUNLESS OTHERWISE SPECFED TOLERANCES PER DECIMAL PRECISION ARE: X=±1 (±0,039), XX=±0.5 (±0,039), XXX=±0.25 (±0,010), XXXX=±0.127 (±0,005). LEAD SIZE=±0.05 (±0,002), LEAD LENGTH=±0.75 (±0,030). NN=+0.000 NAX.=+0.000 NAX.=+0.000

LPA-C011301S-X

CONFIDENTIAL INFORMATION
THE INFORMATION CONTAINED IN THIS DOCUMENT IS THE PROPERTY OF PART NUMBER LUMEX INC. EXCEPT AS SPECIFICALLY AUTHORIZED IN WRITING BY LUNEX

INC., THE HOLDER OF THIS DOCUMENT SHALL KEEP ALL INFORMATION CONTAINED HEREIN CONFIDENTIAL AND SHALL PROTECT SAME IN WHOLE OR IN PART FROM DISCLOSURE AND DISSEMINATION TO ALL THIRD PARTIES.

RELIABILITY NOTE

OUR MANY YEARS OF EXPERIENCE DATA ACCUMULATION INDICATE THAT SOLDER HEAT IS A MAJOR CAUSE OF EARLY AND FUTURE FAILURE. PLEASE PAY ATTENTION TO YOUR SOLDERING PROCESS.



290 E. HELEN ROAD PALATINE, IL 60067-6976 PHONE: +1.847.359.2790 US WEB: www.lumex.com TW WEB: www.lumex.com.tw

DRAWN BY:

CHECKED BY:

APPROVED BY:

DATE: 6.20.02 PAGE: 1 OF 1 SCALE: N/A

3mm SINGLE UNIT, SMT, VERTICAL LIGHT PIPE,

GB

Mouser Electronics

Authorized Distributor

Click to View Pricing, Inventory, Delivery & Lifecycle Information:

Lumex:

LPA-C011301S-10 LPA-C011301S-20 LPA-C011301S-15 LPA-C011301S-4